

**Pacific Northwest  
National Laboratory**

Operated by Battelle for the  
U.S. Department of Energy

00S1552


**Post-Closure Groundwater  
Monitoring Plan for the 1324-N  
Surface Impoundment and  
1324-NA Percolation Pond**

M. J. Hartman

**RECEIVED**  
APR 14 2004

**EDMC**

April 2004

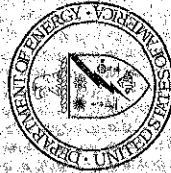

Prepared for the U.S. Department of Energy  
under Contract DE-AC06-76RL01830



## **DISCLAIMER**

This report was prepared as an account of work sponsored by an agency of the United States Government. Reference herein to any specific commercial product, process, or service by trade name, trademark, manufacturer, or otherwise does not necessarily constitute or imply its endorsement, recommendation, or favoring by the United States Government or any agency thereof, or Battelle Memorial Institute.

**PACIFIC NORTHWEST NATIONAL LABORATORY**

*operated by*

**BATTELLE**

*for the*

**UNITED STATES DEPARTMENT OF ENERGY**

*under Contract DE-AC06-76RL01830*

**Printed in the United States of America**

**Available to DOE and DOE contractors from the  
Office of Scientific and Technical Information, P.O. Box 62, Oak Ridge, TN 37831-0062;  
prices available from (615) 576-8401**

**Available to the public from the National Technical Information Service,  
U.S. Department of Commerce, 5285 Port Royal Rd., Springfield, VA 22161**

**ph: (800) 553-6847**

**fax: (703) 605-6900**

**email: [orders@ntis.fedworld.gov](mailto:orders@ntis.fedworld.gov)**

**online ordering: <http://www.ntis.gov/ordering.htm>**



This document was printed on recycled paper.



**Post-Closure Groundwater  
Monitoring Plan for the 1324-N  
Surface Impoundment and  
1324-NA Percolation Pond**

M. J. Hartman

April 2004

Prepared for  
the U.S. Department of Energy  
under Contract DE-AC06-76RL01830

Pacific Northwest National Laboratory  
Richland, Washington 99352



## Executive Summary

The 1324-N Surface Impoundment and the 1324-NA Percolation Pond, located in the 100-N Area of the Hanford Site, are regulated under the *Resource Conservation and Recovery Act* (RCRA). Surface and underground features of the facilities have been removed and laboratory analyses showed that soil met the closure performance standards. The sites have been backfilled and revegetated.

This document will replace the previous RCRA monitoring plans (Hartman 2002 and RCRA monitoring portion of Borghese et al. 1996) for the 1324-N and 1324-NA facilities after it is incorporated into the Hanford Facility RCRA Permit (Ecology, 1989). Monitoring for two other 100-N Area RCRA facilities, the 1301-N and 1325-N facilities, was included in Hartman (2002) but is now described in a separate monitoring plan (Hartman 2004).

This document describes RCRA post-closure monitoring for the period following surface closure until a final groundwater record of decision is made for the 100-NR-2 operable unit, of which 1324-N/NA groundwater is a part. After final groundwater decisions are made for the operable unit, this plan may need to be revised to reflect these decisions.

The monitoring network comprises the following wells:

Near-Field Wells	Plume-Tracking Wells	
199-N-59	199-N-2	199-N-26
199-N-71 (upgradient)	199-N-3	199-N-34
199-N-72	199-N-16	199-N-56
199-N-73	199-N-19	199-N-57
199-N-77 (deeper well)	199-N-21	199-N-64
		199-N-67

The downgradient, near-field wells are sampled semiannually and the other wells are sampled annually for the following parameters:

Sulfate	Other metals <sup>(a)</sup>
Sodium (filtered)	calcium (filtered)
Other anions <sup>(a)</sup>	magnesium (filtered)
alkalinity	potassium (filtered)
chloride	Field parameters
nitrate	specific conductance
	pH
(a) Samples analyzed for anions and dissolved metals.	

RCRA groundwater monitoring for the 1324-N/NA facilities is part of the groundwater project. Project staff schedule sampling and initiate paperwork. The project uses subcontractors for sample collection, shipping, and analysis. The groundwater project's quality control program is designed to assess and enhance the reliability and validity of groundwater data. This is accomplished through evaluating the results of quality control samples, conducting audits, and validating groundwater data.



## **Acknowledgments**

Many thanks to Christopher Thompson of the Groundwater Project, who provided the Quality Control information presented in this document. Thanks also to Stuart Luttrell for providing a peer review.



# Contents

Executive Summary .....	iii
Acknowledgments.....	v
1.0 Introduction.....	1.1
1.1 Waste Characteristics .....	1.2
1.2 Post-Closure Monitoring Approach .....	1.3
1.3 Summary of Previous RCRA Groundwater Monitoring .....	1.4
2.0 Conceptual Model .....	2.1
3.0 Groundwater Monitoring Program.....	3.1
3.1 Monitoring Well Network .....	3.1
3.2 Constituent List and Sampling Frequency .....	3.2
3.3 Water Level Monitoring .....	3.2
3.4 Sampling and Analysis Protocol .....	3.3
3.4.1 Scheduling Groundwater Sampling.....	3.3
3.4.2 Chain of Custody.....	3.3
3.4.3 Sample Collection .....	3.4
3.4.4 Analytical Protocols .....	3.4
4.0 Quality Assurance .....	4.1
4.1 Quality Control Criteria.....	4.2
4.2 Groundwater Data Validation Process .....	4.3
5.0 Data Management and Reporting.....	5.1
5.1 Loading and Verifying Data.....	5.1
5.2 Data Review .....	5.1
5.3 Interpretation .....	5.2



5.4	Reporting.....	5.2
6.0	References.....	6.1
Appendix A - As-Built Diagrams of Monitoring Wells.....		A.1



## Figures

1.1	Groundwater Monitoring Wells in the 100-N Area.....	1.1
1.2	Average Sulfate Concentrations in the 100-N Area .....	1.5
1.3	Long-Term Sulfate Trend in Well 199-N-59, Monitoring 1324-N/NA Facilities .....	1.6
1.4	Sulfate Trends in Wells 199-N-59, 199-N-72, and 199-N-73, Monitoring 1324-N/NA Facilities.....	1.6
1.5	Average Nitrate Concentrations in 100-N Area.....	1.7
1.6	Long-Term Nitrate Trend in Well 199-N-59, Monitoring 1324-N/NA Facilities .....	1.8

## Tables

1.1	Selected Results of Waste Analysis of 163-N Demineralization Plant Effluent, August 1987, and 183-N Filtered Water Plant Backwash Effluent, August 1985.....	1.3
3.1	Wells for Post-Closure Groundwater Monitoring at the 1324-N/NA Site.....	3.1
4.1	Quality Control Samples.....	4.1
4.2	Recovery Limits for Double Blind Standards.....	4.2



## 1.0 Introduction

The 1324-N and 1324-NA facilities are *Resource Conservation and Recovery Act* (RCRA) units in the 100-N Area of the Hanford Site. This document describes RCRA groundwater monitoring, conducted as part of the Groundwater Performance Assessment Project (groundwater project). This monitoring plan will be implemented upon approval of a modification to the Hanford Facility RCRA Permit (Ecology, 1989) that cites this plan.

The 1324-N/NA facilities (Figure 1.1) were used to treat and dispose of effluent from a water demineralization plant and related facilities. The 1324-NA Percolation Pond (also known as the 120-N-1

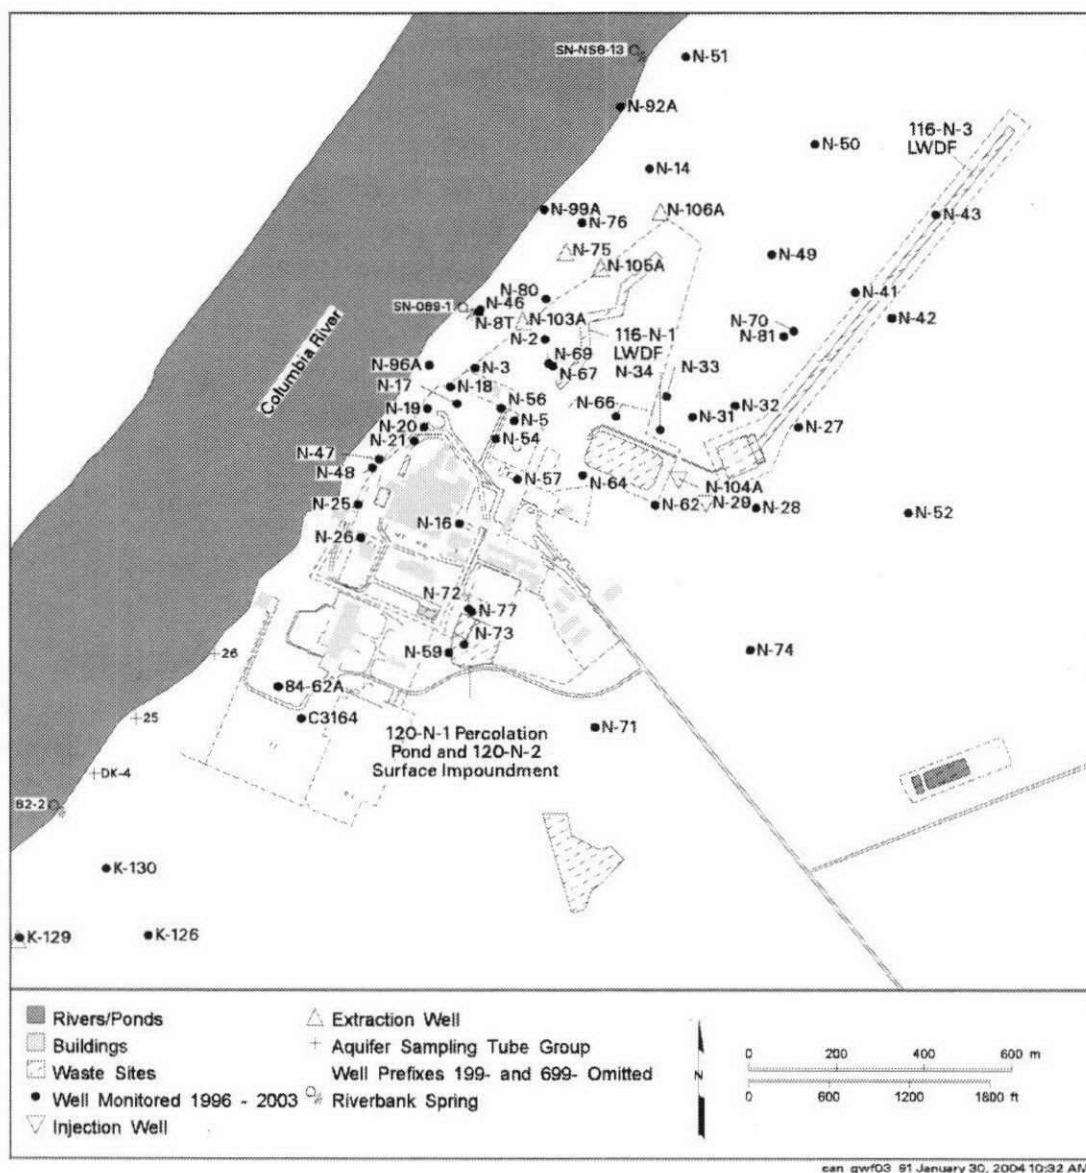


Figure 1.1. Groundwater Monitoring Wells in the 100-N Area



waste site) was an unlined pond that was used to neutralize and dispose of corrosive waste from 1977 to 1986 and to dispose of pre-neutralized waste from 1986 through 1991. The adjacent 1324-N surface impoundment (also known as the 120-N-2 waste site) was used to neutralize waste from 1986 to 1988. It was a double-lined pond with a leachate collection system. No leaks were detected throughout its period of use.

Soil samples were collected from the site in 1992 and 1993 from the surface to as deep as 23 meters. The samples were analyzed for heavy metals, organics, cyanide, pH, and anions. Organic constituents were not detected and concentrations of other constituents were within background ranges (DOE 2002).

As required by the closure plan, surface facilities (sampling shed, liner) and underground features (leachate collection system, delivery pipeline) have been removed. Samples were collected from soil remaining at this site. Results indicate the remedial action objectives have been met (BHI 2001). The facilities have been backfilled and revegetated. A Certification of Closure by a professional engineer has been completed for these facilities.<sup>(a)</sup>

The facilities are combined into a single waste management area for groundwater monitoring because they are adjacent to one another and the same type of waste was treated or stored in both. The percolation pond has contaminated groundwater with sulfate and sodium, which are nonhazardous constituents. Post-closure groundwater monitoring is required due to this contamination.

The closure plan for the 1324-N/NA facilities states, "During the post-closure period, monitoring of groundwater will continue under a corrective action program in accordance with WAC 173-303-645(11). A groundwater monitoring plan will be developed for 1324-N and 1324-NA and implemented prior to incorporation of this post-closure plan into the Permit. ... Because the groundwater monitoring data continues to show exceedances of sulfate concentrations above the secondary drinking water standard (250 mg/L), corrective action to remove or treat the sulfate will be required. Corrective actions will be determined in a ROD for the 100-NR-2 OU" (Appendix B of DOE 2002).

The final decision for cleanup of the sulfate plume will be made as part of the 100-NR-2 groundwater operable unit, which includes groundwater beneath the entire 100-N Area. Until that decision is made, the objectives of RCRA post-closure monitoring are (a) to track trends in sulfate compared to the drinking water standard, and (b) to define the extent of the sulfate plume. Thus, no statistical evaluations are necessary.

## **1.1 Waste Characteristics**

The effluent discharged to the 1324-N and 1324-NA facilities originated at the 163-N Demineralizer Plant and the 183-N Filtered Water Plant. Neither effluent stream contained listed constituents.

---

(a) Letter from J. Hebdon, U.S. Department of Energy Richland Operations Office (DOE-RL) to M. Wilson, Washington State Department of Ecology, "Certification of Closure for the 1324-N Surface Impoundment and 1324-NA Percolation Pond," dated February 7, 2003.



However, effluent from the demineralizer plant was classified as corrosive dangerous waste (Appendix B of DOE 2002). Table 1.1 contains selected results of chemical analyses of effluent streams while the facilities were in use.

The hazardous waste treated and disposed of at the facilities was produced by the regeneration of ion exchange columns in the 163-N Demineralizer Plant. The wastes consisted of acid and caustic regeneration fluids and process and cooling water flushes. The pH of the demineralized water plant wastes varied from less than 1.0 to as high as 14 standard units. These discharges qualified as corrosive dangerous wastes defined in WAC 173-303-090(a)(i). The regeneration solutions would have contained a variety of metal constituents as a result of concentration on the ion exchange media. These metals were not detected at levels that would regulate them as characteristic waste (WAC 173-303-090) (Appendix B of DOE 2002).

## 1.2 Post-Closure Monitoring Approach

Post-closure monitoring at the 1324-N/NA facilities has been developed to meet the standards for a corrective-action monitoring program under WAC 173-303-645(11) (Appendix B of DOE 2002). The interim remedial action record of decision for the 100-NR-1 and 100-NR-2 operable units (ROD 1999) explains that, "It is the intent of the Tri-Parties to select the same remedy for sites requiring RCRA corrective action as selected for those sites requiring *Comprehensive Environmental Response, Compensation, and Liability Act* (CERCLA) interim remedial actions." Until a final decision on remedial action of the sulfate plume is made for the 100-NR-2 operable unit, the plume will attenuate due to spreading, movement, and chemical interaction with sediment. RCRA groundwater monitoring during this initial period of post-closure monitoring will focus on defining sulfate concentration trends and plume extent, and comparing concentrations to the 250-mg/L secondary drinking water standard. This objective complements operable unit monitoring, which includes an objective to "...further define the

**Table 1.1. Selected Results of Waste Analysis of 163-N Demineralization Plant Effluent, August 1987, and 183-N Filtered Water Plant Backwash Effluent, August 1985 (from Appendix B of DOE 2002)**

Parameter (minimum detection limit, units)	163-N Demineralization Plant (corrosive waste) <sup>(a)</sup>	183-N Filtered Water Plant (non-dangerous effluent) <sup>(b)</sup>
Calcium (0.05 mg/L)	318.3/ND	17.4
Chloride (0.5 mg/L)	1.9/2.4	2.81
pH (standard units)	0.917/13.74	7.46
Potassium (0.1 mg/L)	14.2/26.7	0.792
Nitrate (0.5 mg/L)	0.8/1.1	0.596
Sodium (0.1 mg/L)	12.8/27,150	2.23
Sulfate (0.5 mg/L)	3,201/30.7	19.7
Specific Conductance (µS/cm)	37,367/64,000	153
(a) Average for cation regeneration cycle/Average for anion regeneration cycle.		
(b) Average.		
ND = not detected		



extent and nature of contaminant plumes for the other contaminants of concern, [including] sulfate.... This... objective will provide information that can be used to help determine a final groundwater remedial action...." (ROD 1999).

This RCRA monitoring plan may need to be revised in the future to reflect the final record of decision for the 100-NR-2 groundwater operable unit.

### **1.3 Summary of Previous RCRA Groundwater Monitoring**

RCRA groundwater monitoring at the 1324-N/NA site began in December 1987. After the first year of background monitoring, the downgradient wells then in use (199-N-58 through 199-N-61) all exceeded the critical mean value for specific conductance. The site was monitored under an assessment program from 1989 until 1992. The assessment report (Hartman 1992) concluded that the elevated specific conductance was due to the nondangerous constituents sulfate and sodium. From 1993 until 1995 the site was monitored under another assessment program for elevated total organic halides. The associated assessment report (Hartman 1995) concluded that the elevated total organic halides originated from nondangerous discharges to a nearby facility and RCRA indicator-evaluation monitoring resumed. Total organic halide levels subsequently declined to background, but specific conductance in downgradient wells continues to exceed the critical mean value.


When the 1324-N/NA facilities were incorporated into the Hanford Facility RCRA Permit in 1999, monitoring continued under the existing interim-status plan (Borghese et al. 1996 with details in Hartman 1996 and, later, Hartman 2002). Interim-status indicator evaluation monitoring continued before and during the closure period.

Groundwater monitoring shows the continued presence of elevated sulfate and sodium, with correspondingly high specific conductance. The sulfate plume extends toward the Columbia River (Figure 1.2). Only well 199-N-59 exceeded the secondary drinking water standard for sulfate (250 mg/L) in fiscal years 2001 or 2002. The maximum sulfate concentration in this well during fiscal year 2002 was 384 mg/L. Sulfate concentrations have been below the primary drinking water standard (500 mg/L) in all wells since 1991.

While the 1324-NA percolation pond was in use, sulfate concentrations in adjacent wells reached peaks of 1,500 to greater than 2,000 mg/L. Well 199-N-59 is the only original monitoring well that did not go dry in 1990. Sulfate concentrations in this well declined sharply after discharges ceased in 1990 (Figure 1.3), and were below the drinking water standard occasionally between 1991 and 1995. After 1995, sulfate levels gradually rose and stabilized at their current level of ~300 mg/L in well 199-N-59.

Sulfate trends in wells 199-N-72 and 199-N-73, installed in 1991, were relatively low during the first two to three years of monitoring, then sharply increased, peaking around 1995 (Figure 1.4). Levels have declined steadily since then. Sulfate concentrations currently are lower in these wells than in 199-N-59. These differences may reflect vertical or horizontal heterogeneities in the sulfate plume.




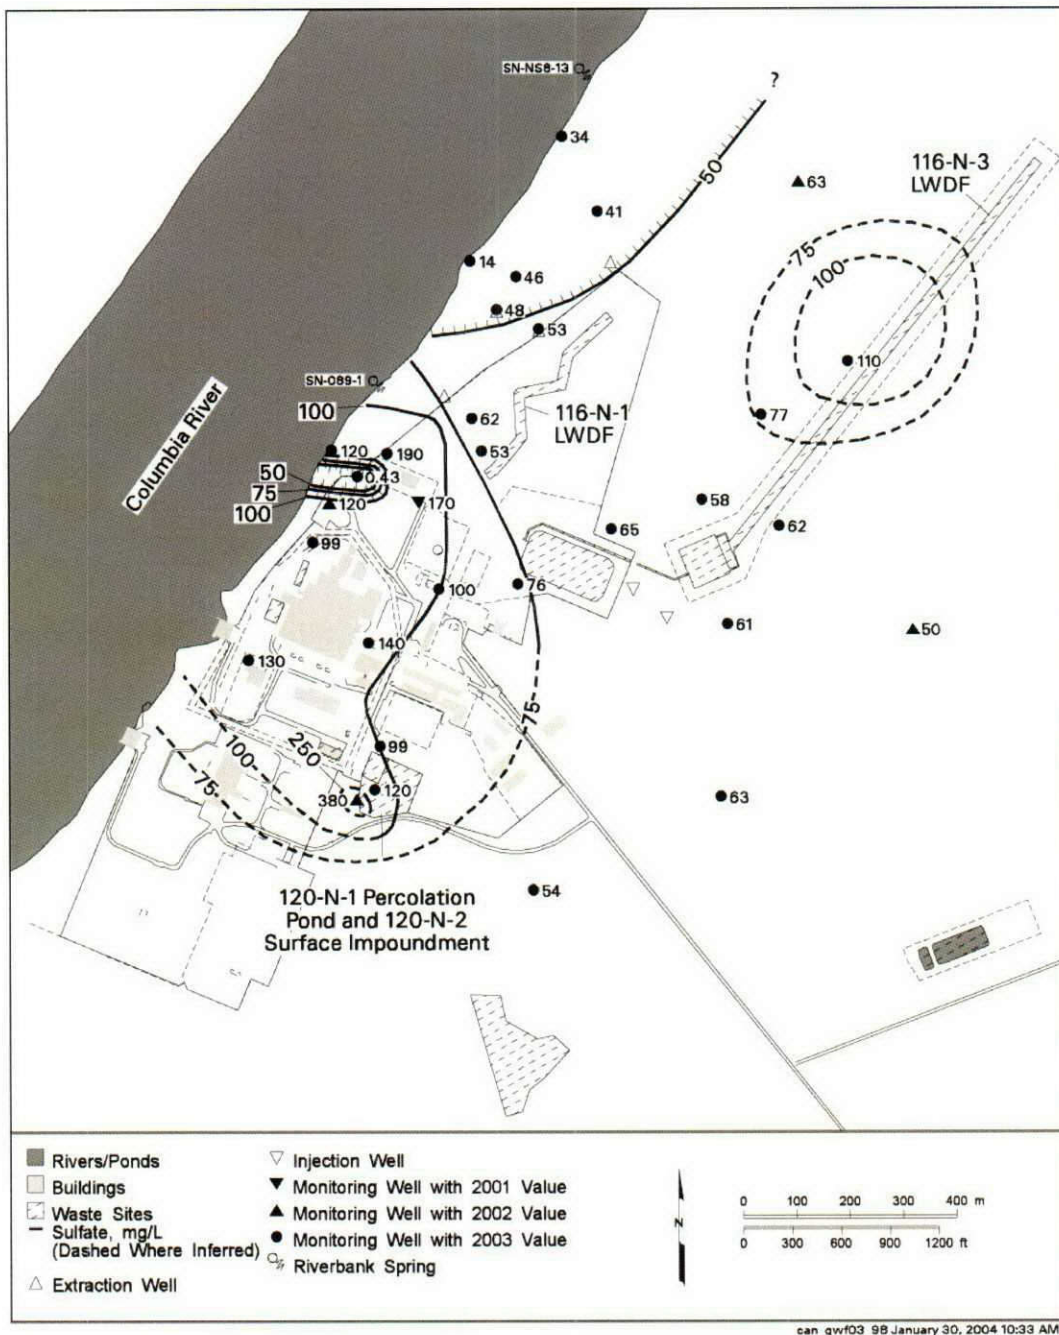


**Figure 1.2. Average Sulfate Concentrations in the 100-N Area**

Nitrate is elevated in groundwater beneath several portions of the 100-N Area, including the 1324-N/NA site (Figure 1.5). The source is not believed to be the 1324-N/N facilities because analysis of waste while the facilities were in use showed only low concentrations of nitrate (see Table 1.1). Nitrate concentrations also were low in groundwater samples collected before 1991 while the 1324-NA percolation pond was in use (Figure 1.6).



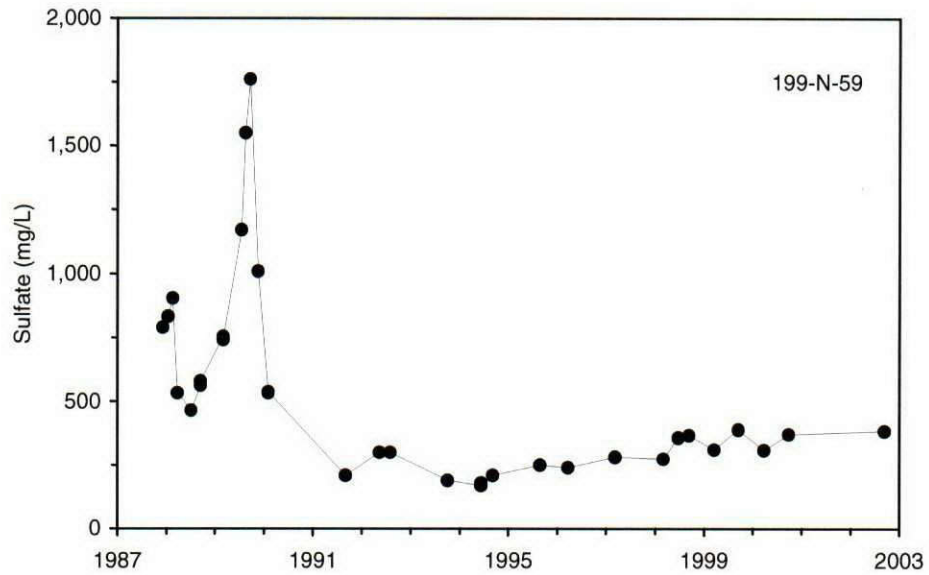


**Figure 1.3. Long-Term Sulfate Trend in Well 199-N-59, Monitoring 1324-N/NA Facilities**

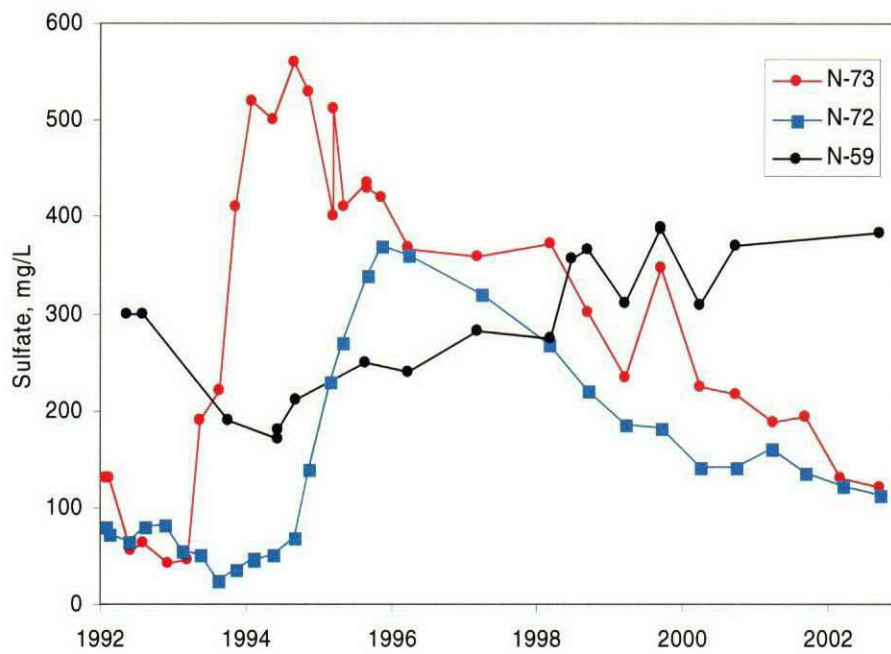


**Figure 1.4. Sulfate Trends in Wells 199-N-59, 199-N-72, and 199-N-73, Monitoring 1324-N/NA Facilities**





1.7



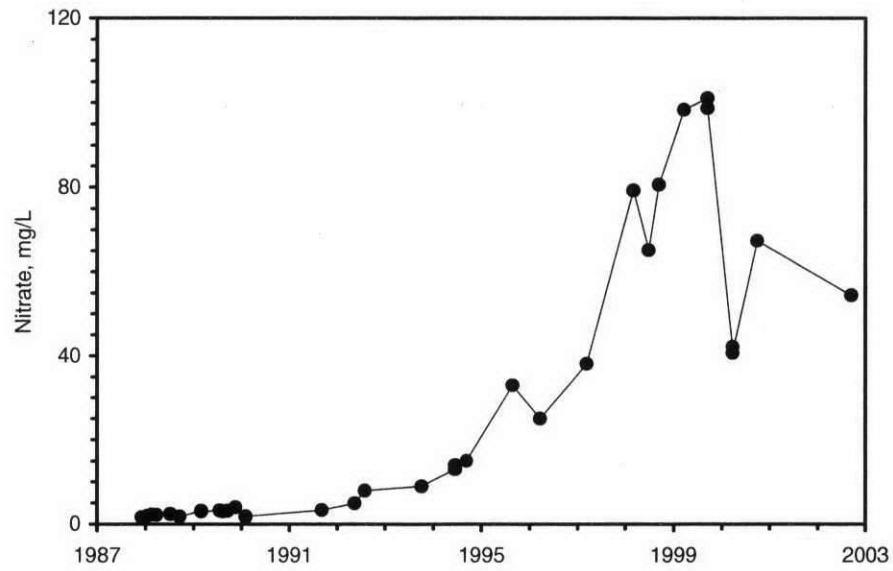

**Figure 1.6. Long-Term Nitrate Trend in Well 199-N-59, Monitoring 1324-N/NA Facilities**



## 2.0 Conceptual Model

A groundwater conceptual model is an evolving hypothesis that identifies the important features, events, and processes that control groundwater and contaminant movement. This model is based on results of previous geological and hydrogeological studies, sediment sampling, and groundwater monitoring. Primary references are Hartman and Lindsey (1993), Gilmore et al. (1992), DOE (2002), and groundwater monitoring annual reports (e.g., Hartman et al. 2003). The model provides a basis for designing a groundwater monitoring program.

The conceptual model for the 1324-N/NA facilities includes the following elements:

- The uppermost aquifer is unconfined, ~12-15 meters thick, and is contained in a sand and gravel unit in the Ringold Formation. Gilmore et al. (1992) estimated a representative range of transmissivity for the 100-N Area to be 93 to 560 m<sup>2</sup>/d.
- The base of the uppermost aquifer is a fine-grained unit of interbedded silt and clay. The existence of deeper confined aquifers in the Ringold sediment and in the basalt-confined aquifer system is inferred on the basis of geologic interpretation and limited borehole data from the surrounding area, but there is little potential for downward migration of 100-N Area contaminants.
- Because the site has been backfilled and revegetated, most of the precipitation is removed by evapotranspiration. Thus, little infiltration will occur through the site.
- The 1324-N surface impoundment did not leak and therefore did not contaminate the vadose zone or groundwater.
- The 1324-NA percolation pond introduced non-hazardous contaminants, primarily sulfate and sodium, through the vadose zone to groundwater. The pH of the effluent ranged from 1 to 14, causing it to be classified as hazardous, but mixing in the pond and neutralization in the sediment prevented the high-pH or low-pH water from reaching groundwater.
- While the percolation pond was active, artificial recharge formed a groundwater mound that created radial flow. Chemical impacts from the pond discharge migrated an unknown distance inland. After use of the pond ceased, groundwater flow returned to a northwest or north direction.
- Sulfate and sodium move readily with groundwater toward the north and northwest to the Columbia River. There appears to be continuing drainage of water from the vadose zone, since concentrations are remaining high many years after disposal ceased. These constituents cause the groundwater to have a high specific conductance.
- Sodium exchanges for calcium in vadose and aquifer sediments causing sodium concentrations in groundwater to decline while calcium concentrations increase as the water moves downgradient.



### 3.0 Groundwater Monitoring Program

This section describes the post-closure RCRA monitoring program for the 1324-N/NA facilities, which is designed to track plume extent and contaminant trends until final cleanup decisions are made.

#### 3.1 Monitoring Well Network

The post-closure monitoring network (Table 3.1) includes:

- Four near-field wells adjacent to the 1324-N/NA facilities (199-N-59, 199-N-72, 199-N-73, and 199-N-77) to track concentration trends in the area of highest contamination.

**Table 3.1. Wells for Post-Closure Groundwater Monitoring at the 1324-N/NA Site**

Well	Purpose; Comments	Well Standard <sup>(a)</sup>	Primary Constituents		Constituents Supporting Interpretation			Field Parameters				
			Sulfate	Sodium	Alkalinity	Anions <sup>(b)</sup>	Metals, filtered <sup>(c)</sup>	Specific Conductance	pH	Temperature	Turbidity	Water Levels
199-N-2	Far-field plume definition	PRE	A	A	A	A	A	A	A	A	A	A
199-N-3	Far-field plume definition	PRE	A	A	A	A	A	A	A	A	A	A
199-N-16	Far-field plume definition	PRE	A	A	A	A	A	A	A	A	A	A
199-N-19 <sup>(d)</sup>	Far-field plume definition	PRE	A	A	A	A	A	A	A	A	A	A
199-N-21 <sup>(d)</sup>	Far-field plume definition	PRE	A	A	A	A	A	A	A	A	A	A
199-N-26 <sup>(d)</sup>	Far-field plume definition	PRE	A	A	A	A	A	A	A	A	A	A
199-N-34	Far-field plume definition	PRE	A	A	A	A	A	A	A	A	A	A
199-N-56	Far-field plume definition	WAC	A	A	A	A	A	A	A	A	A	A
199-N-57	Far-field plume definition	WAC	A	A	A	A	A	A	A	A	A	A
199-N-59	Near-field plume; sometimes dry <sup>(e)</sup> ; highest sulfate concentrations	WAC	SA	SA	SA	SA	SA	SA	SA	SA	SA	SA
199-N-64	Far-field plume definition	WAC	A	A	A	A	A	A	A	A	A	A
199-N-67	Far-field plume definition	WAC	A	A	A	A	A	A	A	A	A	A
199-N-71	Upgradient	WAC	A	A	A	A	A	A	A	A	A	A
199-N-72	Near-field plume	WAC	SA	SA	SA	SA	SA	SA	SA	SA	SA	SA
199-N-73	Near-field plume	WAC	SA	SA	SA	SA	SA	SA	SA	SA	SA	SA
199-N-77	Near-field plume; bottom of aquifer	WAC	SA	SA	SA	SA	SA	SA	SA	SA	SA	SA

(a) PRE = Well not constructed to Washington Administrative Code (WAC 173-160) standards.

WAC = Well constructed to Washington Administrative Code (WAC 173-160) standards.

(b) Anions analysis includes at a minimum chloride, nitrate, and sulfate.

(c) Metals analysis includes at a minimum calcium, magnesium, potassium, and sodium. Analyses will be run on filtered samples pending Ecology's policy decision on filtered/unfiltered metals.

(d) Candidates for decommissioning. If any of these wells are decommissioned, Ecology will be notified and the monitoring program will be reevaluated to determine if new well(s) are needed.

(e) Well 199-N-59 was drilled when the 1324-NA pond had artificially raised the water table. When the water table is low, it does not contain enough water to sample.



- One upgradient well to provide information on groundwater quality not affected by the 1324-N/NA facilities.
- Eleven wells farther downgradient of the facilities to define the sulfate plume at levels below the secondary drinking water standard.

All of the wells except 199-N-77 monitor the top of the unconfined aquifer. Well 199-N-77 monitors the bottom of the unconfined aquifer, with the screen placed above a fine-grained unit in the Ringold Formation. The wells adjacent to the 1324-N/NA facilities are constructed to the standards of WAC 173-160 for resource protection wells. Many of the far-field wells were constructed before those standards were adopted. As-built diagrams of all of the wells are included in the Appendix.

All of the far-field wells and some of the near-field wells are sampled for objectives of the 100-NR-2 Operable Unit and/or the *Atomic Energy Act of 1954* (AEA). Sampling is coordinated to avoid redundancy.

If a monitoring well becomes unsuitable for use, Ecology will be notified formally. The monitoring program will be reevaluated to determine if a new or existing well should be substituted. If a new well must be installed, a drilling schedule will be provided.

### **3.2 Constituent List and Sampling Frequency**

Sulfate and sodium are the primary constituents of interest for 1324-N/NA RCRA groundwater monitoring. Additional constituents will continue to be monitored for supporting information (see Table 3.1).

The downgradient, near-field wells will be sampled semiannually to provide a clear record of chemistry trends. Other wells provide supporting data and will be sampled annually (see Table 3.1).

### **3.3 Water Level Monitoring**

Samplers measure depth to water in each well before sampling, according to procedure DFSNW-SSPM-001 SP 3-3. The depth to water is subtracted from the elevation of a reference point (usually top of casing) to obtain water level elevation. Water level elevations are used to construct water table maps of the 100-N Area.

Groundwater flow direction beneath the 1324-N/NA facilities is inferred from the water table map(s) and plume maps. Rate of flow is estimated from hydraulic gradient, hydraulic conductivity, and porosity, or from rates of contaminant movement.



### **3.4 Sampling and Analysis Protocol**

RCRA groundwater monitoring for the 1324-N/NA facilities is part of the groundwater project. This section describes the groundwater project's protocols for sample collection and analysis. Project staff schedule sampling and initiate paperwork. The project uses subcontractors for sample collection, shipping, and analysis.

#### **3.4.1 Scheduling Groundwater Sampling**

The groundwater project schedules well sampling. Many Hanford Site wells are sampled for multiple objectives and requirements, e.g., RCRA, CERCLA, AEA. Scheduling activities help manage the overlap, eliminating redundant sampling and meeting the needs of each sampling objective. Scheduling activities include the following:

- Each fiscal year, project scientists provide well lists, constituent lists, and sampling frequency. Each month, project scientists review the sampling schedule for the following month. Changes are requested via change request forms and approved by the sampling and analysis task lead and the monitoring project manager.
- Project staff track sampling and analysis through an electronic schedule database, stored on a server at Pacific Northwest National Laboratory (PNNL). Quality control samples also are managed through this database. A scheduling program generates unique sample numbers and a special user interface generates sample authorization forms, field services reports, groundwater sample reports, chain-of-custody forms, and sample container labels.
- Sampling and analysis staff verify that well name, sample numbers, bottle sizes, preservatives, etc., are indicated properly on the paperwork, which is transmitted to the sampling subcontractor. Staff complete a checklist to document that the paperwork was generated correctly.
- At each month's end, project staff use the schedule database to determine if any wells were not sampled as scheduled. If the wells or sampling pumps require maintenance, they are rescheduled following repair. If a well can no longer be sampled, it is cancelled and the reason is recorded in the database. DOE will notify Ecology if sampling is delayed past the end of the scheduled quarter or if a well cannot be sampled (see Sections 3.1 and 5.4). Should repairs require an extended effort (>60 days), Ecology will be consulted and a repair schedule approved.

#### **3.4.2 Chain of Custody**

The sampling subcontractor uses chain-of-custody forms to document the integrity of groundwater samples from the time of collection through data reporting. The forms are generated during scheduling (see Section 3.4.1) and managed through subcontractor procedure DFSNW-SSPM-001 SP 1-1.



### **3.4.3 Sample Collection**

The procedure for groundwater sampling is described in DFSNW-SSPM-001 SP 3-1. Samples generally are collected after three casing volumes of water have been purged from the well or after field parameters (pH, temperature, specific conductance, and turbidity) have stabilized (i.e., after two consecutive measurements are within 0.2 units pH, 0.2°C for temperature, 10% for specific conductance, and turbidity <5 Nephelometric Turbidity Units (NTU). For routine groundwater samples, preservatives are added to the collection bottles if necessary before their use in the field according to procedure DFSNW-SSPM-001 SP 2-1.

Ecology is developing a policy decision concerning the analysis of metals in filtered and/or unfiltered samples. For 1324-N/NA groundwater monitoring, samples for metals analyses will be filtered in the field unless unfiltered analyses are required by Ecology.

### **3.4.4 Analytical Protocols**

Procedures for field measurements are specified in subcontractor's procedures DFSNW-SSPM-001 SP 6-2 (turbidity), SP 6-3 (pH), SP 6-5 (specific conductance), and SP 6-7 (temperature). Each instrument is assigned a unique number that is tracked on field documentation and is calibrated and controlled according to procedure DFSNW-SSPM-001 6-1. Additional calibration and use instructions are specified in the instrument user's manuals.

Laboratory analytical methods are specified in contracts with the laboratories, and most are standard methods from *Test Methods for Evaluating Solid Wastes, Physical/Chemical Methods* (Environmental Protection Agency [EPA] 1986c). Alternative procedures meet the guidelines of EPA (1986c, Chapter 10). Analytical methods are described in Section 8 of Hartman (2000).



## 4.0 Quality Assurance

The groundwater project's quality assurance program follows the requirements of EPA (2001) for quality assurance project plans. Quality control and quality assurance requirements are defined based on data quality objectives (EPA 2000).

The groundwater project's quality control program is designed to assess and enhance the reliability and validity of groundwater data. This is accomplished through evaluating the results of quality control samples, conducting audits, and validating groundwater data. This section describes the quality control program for the entire groundwater project, which includes the 1324-N/NA facilities.

The quality control practices of the groundwater project are based on guidance from the U.S. Environmental Protection Agency (EPA 1979, EPA 1986a, EPA 1986b, EPA 1986c). Accuracy, precision, and detection are the primary parameters used to assess data quality (Mitchell et al. 1985). Data for these parameters is obtained from two categories of quality control samples: those that provide checks on field and laboratory activities (field quality control) and those that monitor laboratory performance (laboratory quality control). Table 4.1 summarizes the types of samples in each category along with the sample frequencies and characteristics evaluated.

**Table 4.1. Quality Control Samples**

Sample Type	Primary Characteristics Evaluated	Frequency
<b>Field Quality Control</b>		
Full Trip Blank	Contamination from containers or transportation	1 per 20 well trips
Field Transfer Blank <sup>(a)</sup>	Airborne contamination from the sampling site	1 each day volatile organic compound samples are collected
Equipment Blank <sup>(b)</sup>	Contamination from non-dedicated sampling equipment	1 per 10 well trips or as needed <sup>(c)</sup>
Duplicate Samples	Reproducibility	1 per 20 well trips
<b>Laboratory Quality Control</b>		
Method Blank	Laboratory contamination	1 per batch
Lab Duplicates	Laboratory reproducibility	Method/contract specific <sup>(d)</sup>
Matrix Spike	Matrix effects and laboratory accuracy	Method/contract specific <sup>(d)</sup>
Matrix Spike Duplicate	Laboratory reproducibility and accuracy	Method/contract specific <sup>(d)</sup>
Surrogates	Recovery/yield	Method/contract specific <sup>(d)</sup>
Laboratory Control Sample	Accuracy	1 per batch
Double Blind Standards	Accuracy and precision	Varies by constituent <sup>(e)</sup>

(a) Not applicable for 1324-N/NA – no volatile constituents analyzed.

(b) Not applicable for 1324-N/NA – dedicated sampling equipment used.

(c) When a new type of non-dedicated sampling equipment is used, an equipment blank should be collected every time sampling occurs until it can be shown that less frequent collection of equipment blanks is adequate to monitor the equipment's decontamination procedure.

(d) If called for by the analytical method, duplicates, matrix spikes, and matrix spike duplicates are typically analyzed at a frequency of 1 per 20 samples. Surrogates are routinely included in every sample for most gas chromatographic methods.

(e) Double blind standards containing known concentrations of selected analytes are typically submitted in triplicate or quadruplicate on a quarterly, semi-annual, or annual basis.



## 4.1 Quality Control Criteria

Quality control data are evaluated based on established acceptance criteria for each quality control sample type. For field and method blanks, the acceptance limit is generally two times the instrument detection limit (metals), or method detection limit (other chemical parameters). However, for common laboratory contaminants such as acetone, methylene chloride, 2-butanone, and phthalate esters, the limit is five times the method detection limit. Groundwater samples that are associated (i.e., collected on the same date and analyzed by the same method) with out-of-limit field blanks are flagged with a "Q" in the database to indicate a potential contamination problem.

Field duplicates must agree within 20%, as measured by the relative percent difference (RPD), to be acceptable. Only those field duplicates with at least one result greater than five times the appropriate detection limit are evaluated. Unacceptable field duplicate results are also flagged with a "Q" in the database.

The acceptance criteria for laboratory duplicates, matrix spikes, matrix spike duplicates, surrogates, and laboratory control samples are generally derived from historical data at the laboratories in accordance with EPA (1986c). Typical acceptance limits are within 25% of the expected values, although the limits may vary considerably with the method and analyte. Current values for laboratory duplicates, matrix spikes, and laboratory control samples are 20% RPD, 60%-140%, and 70%-130%, respectively. These values are subject to change if the contract is modified or replaced.

Table 4.2 lists the acceptable recovery limits for the double blind standards. These samples are prepared by spiking background well water (currently wells 699-19-88 and 699-49-100C) with known concentrations of constituents of interest. Spiking concentrations range from the detection limit to the upper limit of concentration determined in groundwater on the Hanford site. Double blind standard results that are outside the acceptance limits are investigated and appropriate actions are taken if necessary.

Holding time is the elapsed time period between sample collection and analysis. Exceeding recommended holding times could result in changes in constituent concentrations due to volatilization, decomposition, or other chemical alterations. Recommended holding times depend on the analytical method, and are listed in the annual groundwater monitoring report (e.g., Table B.8 of Hartman et al. 2003). Data associated with exceeded holding times are flagged with an "H" in the Hanford Environmental Information System (HEIS) database.

Additional quality control measures include laboratory audits and participation in nationally based performance evaluation studies. The contract laboratories participate in national studies such as the

**Table 4.2. Recovery Limits for Double Blind Standards**

Constituent	Frequency	Recovery Limits	Precision Limits (RSD)
Specific conductance	Quarterly	75-125%	25%
Nitrate	Quarterly	75-125%	25%
RSD = Relative Standard Deviation			



EPA-sanctioned Water Pollution and Water Supply Performance Evaluation studies. The groundwater project periodically audits the analytical laboratories to identify and solve quality problems, or to prevent such problems. Audit results are used to improve performance. Summaries of audit results and performance evaluation studies are presented in the annual groundwater monitoring report.

## 4.2 Groundwater Data Validation Process

The groundwater project's data validation process provides requirements and guidance for validation of groundwater data that are routinely collected as part of the groundwater project. Validation is a systematic process of reviewing data against a set of criteria to determine whether the data are acceptable for their intended use. This process applies to groundwater data that have been verified (see Section 5.1) and loaded into HEIS. The outcome of the activities described below is an electronic data set with suspect or erroneous data corrected or flagged. Groundwater project staff document the validation process quarterly by signing a checklist, which is stored in the project file.

Responsibilities for data validation are divided among project staff. Each RCRA unit or geographic region is assigned to a project scientist, who is familiar with the hydrogeologic conditions of that site. The data validation process includes the following elements.

- **Generation of data reports:** Twice each month, data management staff provide tables of newly loaded data to project scientists for evaluation (biweekly reports). Also, after laboratory results from a reporting quarter have been loaded into HEIS, staff produce tables of water-level data and analytical data for wells sampled within that quarter (quarterly reports). The quarterly data reports include any data flags added during the quality control evaluation or as a result of prior data review.
- **Project scientist evaluation:** As soon as practical after receiving biweekly reports, project scientists review the data to identify changes in groundwater quality or potential data errors. Evaluation techniques include comparing key constituents to historical trends or spatial patterns. Other data checks may include comparison of general parameters to their specific counterparts (e.g., conductivity to ions) and calculation of charge balances. Project scientists request data reviews if appropriate (see Section 5.2). If necessary, the lab may be asked to check calculations or reanalyze the sample, or the well may be resampled. After receiving quarterly reports, project scientists review sampling summary tables to determine whether network wells were sampled and analyzed as scheduled. If not, they work with other project staff to resolve the problem. Project scientists also review quarterly reports of analytical and water-level data using the same techniques as for biweekly reports. Unlike the biweekly reports, the quarterly reports usually include a full data set (i.e., all the data from the wells sampled during the previous quarter have been received and loaded into HEIS).
- Staff report results of quality control evaluations informally to project staff, DOE-RL, and Ecology each quarter. Results for each fiscal year are described in the annual groundwater monitoring report.



## **5.0 Data Management and Reporting**

This section describes how groundwater data are stored, retrieved, and interpreted.

### **5.1 Loading and Verifying Data**

The contract laboratories report analytical results electronically and in hard copy. The electronic results are loaded into HEIS. Hard copy data reports and field records are considered to be the record copies and are stored at PNNL. Project staff perform an array of computer checks on the electronic file for formatting, allowed values, data flagging (qualifiers), and completeness. Verification of the hard copy results includes checks for (1) completeness, (2) notes on condition of samples upon receipt by the laboratory, (3) notes on problems that arose during the analysis of the samples, and (4) correct reporting of results. If data are incomplete or deficient, staff work with the laboratory to get the problems corrected. Notes on condition of samples or problems during analysis may be used to support data reviews (see Section 5.2).

Field data such as specific conductance, pH, temperature, turbidity, and depth-to-water, are recorded on field records. Data management staff enter these into HEIS manually through data-entry screens, verify each value against the hard copy, and initial each value on the hard copy.

### **5.2 Data Review**

The groundwater project conducts special reviews of groundwater analytical data or field measurements when results are in question. Groundwater project staff document the process on a "Request for Data Review" (RDR) form and results are used to flag the data appropriately in HEIS. Various staff may initiate an RDR, e.g., project scientists, data management, and quality control. The data review process includes the following steps:

- The initiator fills out required information on the RDR form, such as sample number, constituent, and reason for the request (e.g., "result is two orders of magnitude greater than historical results and disagrees with duplicate"). The initiator recommends an action, such as a data re-check, sample re-analysis, well re-sampling, or simply flagging the data as suspect in HEIS.
- The data review coordinator determines that the RDR does not duplicate a previously submitted RDR, then assigns a unique RDR number and records it on the form. A temporary flag is assigned to the data in HEIS, indicating the data are undergoing review ("F" flag).
- If laboratory action is required, the data review coordinator records the lab's response on the RDR form. Other documentation also may be relevant, such as chain-of-custody forms, field records, calibration logs, or chemist's sheets.
- A project scientist assigned to reviewing RDRs determines and records the appropriate response and action on the RDR form, including changes to be made to the data flags in HEIS. Actions may include updating HEIS with corrected data or result of re-analysis, flagging existing data (e.g., "R"



for reject, "Y" for suspect, "G" for good), and/or adding comments. Data management updates the temporary "F" flag to the final flag in HEIS.

- The data review coordinator signs the RDR form to indicate its closure.
- If an RDR is filed on data that are not "owned" by the groundwater project, the data review coordinator forwards a copy of the partially filled form to the appropriate contact for their action. The RDR is then closed.

## 5.3 Interpretation

After data are validated and verified, the acceptable data are used to interpret groundwater conditions at the site. Interpretive techniques include:

- Hydrographs – graph water levels vs. time to determine decreases, increases, seasonal, or man-made fluctuations in groundwater levels.
- Water-table maps – use water-table elevations from multiple wells to construct contour maps to estimate flow directions. Groundwater flow is assumed to be perpendicular to lines of equal potential.
- Trend plots – graph concentrations of constituents vs. time to determine increases, decreases, and fluctuations. May be used in tandem with hydrographs and/or water-table maps to determine if concentrations relate to changes in water level or in groundwater flow directions.
- Plume maps – map distributions of chemical or radiological constituents in the aquifer to determine extent of contamination. Changes in plume distribution over time aid in determining movement of plumes and direction of flow.
- Contaminant ratios – can sometimes be used to distinguish between different sources of contamination.

## 5.4 Reporting

Reporting requirements for sites undergoing groundwater corrective action state that "The owner or operator must report in writing to the department on the effectiveness of the corrective action program... semiannually." This can be accomplished under the groundwater project's existing reports (e.g., RCRA quarterly reports submitted via e-mail, and annual reports issued in March [e.g., Hartman et al. 2003]). The quarterly reports also inform Ecology if sampling is delayed past the end of the scheduled quarter. Chemistry and water-level data are reviewed after each sampling event and are available in HEIS. When needed, DOE will report specific incidents affecting 1324-N/NA groundwater monitoring (e.g., unsuitable wells, delayed sampling) via letters or meeting minutes as described in Sections 3.1 and 3.4.1.



## 6.0 References

- Atomic Energy Act (AEA). 1954. As amended, Ch. 1073, 68 Stat. 919, 42 USC 2011 et seq.
- Bechtel Hanford, Inc. (BHI). 2002. Cleanup Verification Package/Clean Closure Report for the Soil Column of the 116-N-3 Trench, Crib, and 100-N-63:1 Pipeline. CVP-2002-00002, Bechtel Hanford, Inc., Richland, Washington.
- Borghese JV, MJ Hartman, SP Luttrell, CJ Perkins, JP Zoric, and SC Tindall. 1996. *100-N Pilot Project: Proposed Consolidated Groundwater Monitoring Program*. BHI-00725, Bechtel Hanford, Inc., Richland, Washington.
- Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). 1980. Public Law 96-150, as amended, 94 Stat. 2767, 42 USC 9601 et seq.
- Duratek Federal Services Northwest (DFSNW). *Sampling Services Procedures Manual*. DFSNW-SSPM-001, Duratek Federal Services Northwest, Richland, Washington.
- Gilmore TJ, FA Spane Jr., DR Newcomer, and CR Sherwood. 1992. *Applications of Three Aquifer Test Methods for Estimating Hydraulic Properties Within the 100-N Area*. PNL-8335, Pacific Northwest Laboratory, Richland, Washington.
- Hartman MJ. 1992. Results of Ground Water Quality Assessment Monitoring at the 1301-N Liquid Waste Disposal Facility and 1324-N/NA Facilities. WHC-SD-EN-EV-003, Rev. 1, Westinghouse Hanford Company, Richland, Washington.
- Hartman MJ. 1995. *RCRA Assessment Report: Total Organic Halogen at the 1324-N/NA Site*. WHC-SD-EN-EV-031, Rev. 0, Westinghouse Hanford Company, Richland, Washington.
- Hartman MJ. 1996. *Groundwater Monitoring Plan for the 1301-N, 1325-N, and 1324-N/NA Sites*. WHC-SD-EN-AP-038, Rev. 2, Westinghouse Hanford Company, Richland, Washington.
- Hartman MJ (ed.). 2000. *Hanford Site Groundwater Monitoring: Setting, Sources, and Methods*. PNNL-13080, Pacific Northwest National Laboratory, Richland, Washington.
- Hartman MJ. 2002. *Groundwater Monitoring Plan for the 1301-N, 1324-N/NA, and 1325-N RCRA Facilities*. PNNL-13914, Pacific Northwest National Laboratory, Richland, Washington.
- Hartman MJ. 2004. *Groundwater Monitoring Plan for the 1301-N and 1325-N RCRA Facilities*. PNNL-14357, Pacific Northwest National Laboratory, Richland, Washington.
- Hartman MJ and KA Lindsey. 1993. *Hydrogeology of the 100-N Area, Hanford Site, Washington*. WHC-SD-EN-EV-027, Rev. 0, Westinghouse Hanford Company, Richland, Washington.



Hartman MJ, LF Morasch, and WD Webber (eds.). 2003. *Hanford Site Groundwater Monitoring for Fiscal Year 2002*. PNNL-14187, Pacific Northwest National Laboratory, Richland, Washington.

Mitchell WJ, RC Rhodes, and FF McElroy. 1985. "Determination of Measurement Data Quality and Establishment of Achievable Goals for Environmental Measurements." *Quality Assurance for Environmental Measurements*, ASTM STP 867.

Record of Decision (ROD). 1999. Interim Remedial Action Record of Decision for the 100-NR-1 and 100-NR-2 Operable Units of the Hanford 100-N Area. Washington State Department of Ecology, Olympia, Washington.

Resource Conservation and Recovery Act (RCRA). 1976. Public Law 94-580, as amended, 90 Stat. 2795, 42 USC 6901 et seq.

U.S. Department of Energy (DOE). 2002. *100-NR-1 Treatment, Storage, and Disposal Units Corrective Measures Study/Closure Plan*. DOE/RL-96-39, Rev. 1, U.S. Department of Energy, Richland, Washington.

U.S. Environmental Protection Agency (EPA). 1979. *Handbook for Analytical Quality Control in Water and Wastewater Laboratories*. EPA 600/4-79-019, U.S. Environmental Protection Agency, Cincinnati, Ohio.

U.S. Environmental Protection Agency (EPA). 1986a. *Quality Assurance Manual for Waste Management Branch Investigation*. USEPA Region 10, EPA 910/9-86-00, U.S. Environmental Protection Agency, Washington, D.C.

U.S. Environmental Protection Agency (EPA). 1986b. *Resource Conservation and Recovery Act (RCRA) Groundwater Monitoring Technical Enforcement Guidance Document*. EPA OSWER-9950.1, U.S. Environmental Protection Agency, Washington, D.C.

U.S. Environmental Protection Agency (EPA). 1986c. *Test Methods for Evaluating Solid Waste: Physical/Chemical Methods*. 3<sup>rd</sup> ed as revised. EPA OSWER-SW-846, U.S. Environmental Protection Agency, Washington, D.C.

U.S. Environmental Protection Agency (EPA). 2000. *Guidance for the Data Quality Objectives Process*. EPA/600/R-96-055 (QA/G-4) as revised. U.S. Environmental Protection Agency, Washington, D.C.

U.S. Environmental Protection Agency (EPA). 2001. *EPA Requirements for Quality Assurance Project Plans*. EPA/240/B-01/003 (QA/R-5) as revised. U.S. Environmental Protection Agency, Washington, D.C.

Washington Administrative Code (WAC). "Minimum Standards for Construction and Maintenance of Wells." WAC 173-160, Washington Administrative Code, Olympia, Washington.

Washington Administrative Code (WAC). "Dangerous Waste Characteristics." WAC 173-303-090, Washington Administrative Code, Olympia, Washington.



Washington Administrative Code (WAC). "Releases from Regulated Units." WAC 173-303-645, Washington Administrative Code, Olympia, Washington.

Washington State Department of Ecology (Ecology). 1989. Dangerous Waste Portion of the Resource Conservation and Recovery Act Permit for the Treatment, Storage, and Disposal of Dangerous Waste, as amended. Permit Number WA7890008967, effective September 28, 1994, Washington State Department of Ecology, Olympia, Washington.



## **Appendix A**

### **As-Built Diagrams of Monitoring Wells**



## Appendix A

### As-Built Diagrams of Monitoring Wells

This appendix contains diagrams of wells in the 1324-N/NA RCRA groundwater monitoring network. The diagrams summarize stratigraphy and well construction materials. The diagrams are presented in numerical order.


Monitoring Wells for Post-Closure Monitoring at the 1324-N/NA Facilities.	
Well	Purpose; comments
199-N-2	Far-field plume definition
199-N-3	Far-field plume definition
199-N-16	Far-field plume definition
199-N-19	Far-field plume definition
199-N-21	Far-field plume definition
199-N-26	Far-field plume definition
199-N-34	Far-field plume definition
199-N-56	Far-field plume definition
199-N-57	Far-field plume definition
199-N-59	Near-field plume; sometimes dry <sup>(a)</sup> ; highest sulfate concentrations
199-N-64	Far-field plume definition
199-N-67	Far-field plume definition
199-N-71	Upgradient
199-N-72	Near-field plume
199-N-73	Near-field plume
199-N-77	Near-field plume; bottom of aquifer
(a) Well 199-N-59 was drilled when the 1324-NA pond had artificially raised the water table. When the water table is low, it does not contain enough water to sample.	



WELL CONSTRUCTION AND COMPLETION SUMMARY			
<b>Drilling</b> Method: Cable tool Drilling Fluid Used: Water Driller's Name: Rodda Drilling Company: Bach Dilling Co. Date Started: 25May64	<b>Sample</b> Method: Hard tool (nom) Additives Used: Not documented WA State Lic Nr: Not documented Company Location: Not documented Date Complete: 05Jun64	<b>WELL</b> NUMBER: 199-N-2      A4669      TEMPORARY Hanford Coordinates: N/S N 86,577      E/W W 60,306 State NAD83 N 149,859.43m      E 571,476.21m Coordinates: N 491,724      E 2,234,797 Start Card #: Not documented      T      R      S Elevation Ground surface (ft): 457.1 Estimated	
Depth to water: 60.0-ft Jun64 (Ground surface) 73.8-ft 13Sep94  <b>GENERALIZED</b> Driller's <b>STRATIGRAPHY</b> Log  0-8: SAND, GRAVEL & BOULDERS 9-15: SAND & GRAVEL 15-17: BOULDER 17-100: SAND & GRAVEL 100-105: GRAVEL, SAND & CLAY 105-135: CLAY   REMEDIATION: 24-30May78 by M. Bultena Removed piezometers. Brushed and cleaned. Set cement plug at 95-ft.		Elevation of reference point: [459.13-ft] (top of casing) Height of reference point above [2.0-ft] ground surface  Depth of surface seal [ND] No surface seal documented  9-in nominal hole, 0-125-ft  6-in ID carbon steel casing, +2.0-125-ft   6-in casing perforations, 35-120-ft, 6 holes/rd/ft   Cement plug @ 95-ft  Borehole drilled depth: [125.0-ft]	
Drawing By: RKL/1-N-02.ASB Date : 01Dec94 Reference : HANFORD WELLS		DTB=Depth EG Bottom, 91.3-ft, 13Apr93	

199-N-2

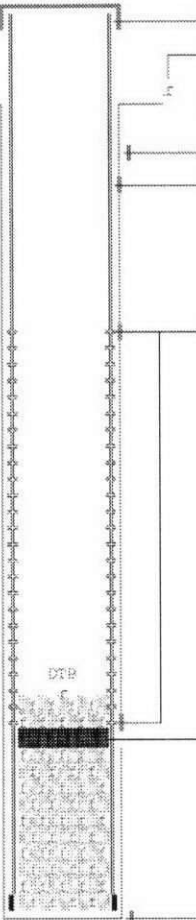

WELL CONSTRUCTION AND COMPLETION SUMMARY			
<b>Drilling</b> Method: Cable tool Fluid Used: Water Driller's: _____ Name: Shafer Drilling Company: Bach Drilling Co. Date: _____ Started: 02Jun64	<b>Sample</b> Method: Hard tool (nom) Additives: _____ Used: Not documented WA State: _____ Lic Nr: Not documented Company: _____ Location: Not documented Date: _____ Complete: 12Jun64	<b>WELL</b> NUMBER: 199-N-3 Hanford Coordinates: N/S N 86,365 E/W W 60,828 State NAD83 N 149,794.61m E 571,317.38m Coordinates: N 491,611 E 2,234,277 Start Card #: Not documented T _____ R _____ S _____ Elevation _____ Ground surface: 457.8-ft Estimated	
Depth to water: 63.0-ft Jun64 (Ground surface) 73.8-ft 13Sep94			
<b>GENERALIZED STRATIGRAPHY</b> Driller's Log 0-11: BOULDERS and DUST 11-15: BOULDERS and SAND 15-17: BOULDER, SAND and DUST 17-20: COBBLES and SAND 20-21: BOULDERS and SAND 21-22: BOULDERS and GRAVEL 22-63: SAND and GRAVEL 63-68: SAND 68-74: SAND and GRAVEL 74-76: SAND 76-92: SAND and GRAVEL 92-104: SAND 104-106: SAND and GRAVEL 106-125: Not documented	 <div style="position: absolute; left: 550px; top: 205px;">             Elevation of reference point: (459.45-ft)              (top of casing)              Height of reference point above (1.7-ft)              ground surface              Depth of surface seal (ND)              No surface seal documented,              9-in nominal hole, 0-125-ft              8-in ID carbon steel casing, +1.7--125-ft              8-in casing perforations,              34-95-ft, cuts not documented              May have cement plug ~95-ft              Borehole drilled depth: (125.0-ft)           </div>		
<b>REMEDIATION:</b> Removal of piezometers and probable setting of plug not documented.			
Drawing By: RML/1-N-03.ASB Date: 01Dec94 Reference: HANFORD WELLS		DTB=Depth to bottom, 61.4-ft, 28Jun94	


199-N-3



WELL CONSTRUCTION AND COMPLETION SUMMARY			
Drilling Method: Rotary	Sample Method: Air returns	WELL NUMBER: 199-N-16 TEMPORARY	
Drilling Fluid Used: Air	Additives Used: Foam, Terg Trim	Hanford N-Area N 6,587	W 6,158
Driller's Name: Nelson P	WA State Lic No: Not documented	Coordinates: N 85,207.94 E/W 60,950.06	State NAD83 N 149,441.65m E 571,281.27m
Company: Nelson Well Drilling	Location: Pasco, WA	Coordinates: N 490,353 E 2,234,156	Start Card #: Not documented T R S
Date Started: 09Feb81	Date Complete: 10Feb81	Elevation Ground surface: 453.5-ft Estimated	
Depth to water: 57.5-ft Feb81 (Ground surface): 88.9-ft 18Mar93		Elevation of reference point: (456.70-ft) [top of casing] Height of reference point above (3.2-ft) ground surface	
GENERALIZED STRATIGRAPHY	Driller's Log	Depth of surface seal (10-ft nom) Type of surface seal: Cement grout to -10-ft	
0-4: GRAVEL and COBBLES with SILT		ND-in hole, 0-10-ft	
4-15: GRAVEL and COBBLES with BOULDERS, SAND		9-in nominal hole, 10-90-ft	
15-20: GRAVEL with SAND, COBBLES, and BOULDERS		9-in ID carbon steel casing, 15.2--20-ft	
20-40: GRAVEL and SAND		8-in casing perforations, 12-78-ft, cuts not documented	
40-45: GRAVEL, COBBLES and SAND			
45-79: GRAVEL and SAND		6-in nom stainless telescoping screen, 51.5-78.5-ft, #10-slot	
79-90: Not documented		7-ft of 5-in pipe with flare on top	
REMEDICATION: 19-Apr84 by M. Bultena Cleaned well. Installed telescoping screen.		Borehole drilled depth: ( 80.0-ft )	
		DTR=Depth to bottom, 78.3-ft, 11Aug92	
Drawing By: RFL/1-N-16.ASE Date : 07Dec94 Reference : HANFORD WELLS			


199-N-16

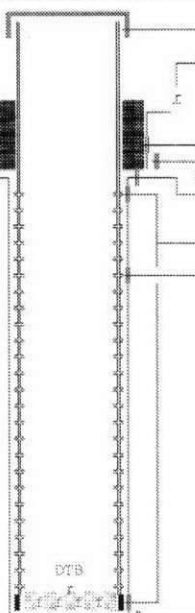

WELL CONSTRUCTION AND COMPLETION SUMMARY			
<b>Drilling</b> Method: Rotary Fluid Used: Air Driller's Name: Nelson ? Drilling Company: Nelson Well Drilling Date Started: 30Jan61	<b>Sample</b> Method: Air returns Additives Used: Foam, Torq Trim WA State Lic Nr: Not documented Company Location: Pasco, WA Date Complete: 30Jan61	<b>WELL</b> NUMBER: 199-N-19      A4668      TEMPORARY Hanford N-Area      N 6,783      WELL NO: Coordinates: N/S      N 96,063.69      E/W      W 61,184.87 State NAD83      N      149,762.45m      E      571,209.05m Coordinates: N      491,203      E      2,233,919 Start Card #: Not documented      T      R      S Elevation Ground surface: 450.9-ft Estimated	
Depth to water: Not documented (Ground surface) 19.6-ft 13Sep94			
<b>GENERALIZED STRATIGRAPHY</b> Driller's Log			
0-10: GRAVEL 6-in minus and COBBLES with SILT to 3-ft 10-15: GRAVEL 6-in minus with COBBLES, SAND and BOULDERS 15-20: GRAVEL 6-in minus zone COBBLES, SAND 20-25: GRAVEL 6-in minus, some COBBLES, SAND 25-30: GRAVEL 6-in minus, SAND 30-45: GRAVEL 4-in minus, SAND 45-62: GRAVEL 6-in minus, SAND and COBBLES 62-64: GRAVEL 6-in minus, SAND and COBBLES 64-77: GRAVEL 6-in minus, SAND 77-78: SAND with GRAVEL		Elevation of reference point: (453.90-ft) (top of casing) Height of reference point above ground surface (3.0-ft) Depth of surface seal (10-ft nom) Type of surface seal, Cement grout to -10-ft (Not documented) ND hole, 0-10-ft (Not documented) 9-in nominal hole, ~10-78-ft 8-in casing perforations, 12-78-ft, cuts not documented 8-in ID carbon steel casing, ~3.0-78-ft Borehole drilled depth: (78.0-ft) DTB=Depth to bottom, 76.8-ft, 05Aug92	
Drawing By: RKL/1-N-19.ASB Date: 07Dec94 Reference: HANFORD WELLS			

199-N-19

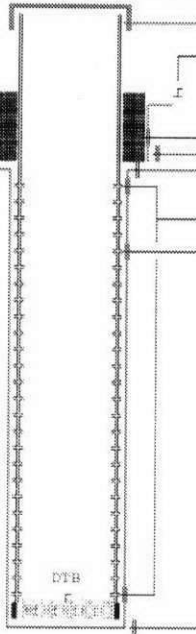

WELL CONSTRUCTION AND COMPLETION SUMMARY			
<b>Drilling</b> Method: Rotary Drilling Additives Fluid Used: Air Driller's Name: Nelson 2 Drilling Company Company: Nelson Well Drilling Date: _____ Date: _____ Started: 16Jan81 Complete: 30Jan81	<b>Sample</b> Method: Air returns Additives Used: Foam, Torq Trim WA State Lic Nr: Not documented Location: Pasco, WA	<b>WELL</b> NUMBER: 199-N-21 A4671 WELL NO: Hanford N-Area N 6,532 W 6,737 Coordinates: N/S N 95,822.95 E/W W 61,284.65 State NAD83 N 143,629.41m E 571,177.78m Coordinates: N 498,967 E 2,233,820 Start Card #: Not documented T R S Elevation Ground surface: 454.1-ft Estimated	
Depth to water: 60.0-ft Jan91 (Ground surface) 71.8-ft 13Sep94 GENERALIZED Driller's STRATIGRAPHY Log		 <p>Diagram labels:</p> <ul style="list-style-type: none"> <li>Elevation of reference point: [457.00-ft] (top of casing)</li> <li>Height of reference point above [2.9-ft] ground surface</li> <li>Depth of surface seal [10-ft nom]</li> <li>Type of surface seal, Cement grout to 10-ft</li> <li>ND hole, 0-10-ft</li> <li>9-in nominal hole, 10-79.5-ft</li> <li>8-in casing perforations, 12-77.8-ft, cuts not documented</li> <li>8-in 10 carbon steel casing, 42.9-79.5-ft</li> <li>Borehole drilled depth: [79.5-ft]</li> <li>DTB-Depth to bottom, 77.2-ft, 09Oct92</li> </ul>	
0-6: GRAVEL and COBBLES with SILT binder 6-9: BOULDER 9-15: COBBLES and GRAVEL 15-20: COBBLES and GRAVEL with SAND 20-25: COBBLES and GRAVEL, SAND with a trace of SILT 25-30: COBBLES, GRAVEL, SAND 30-40: GRAVEL 6-in minus, SAND 40-45: GRAVEL 4-in minus, SAND 45-55: GRAVEL 2-in minus, SAND 55-79.5: GRAVEL 6-in minus, SAND			
Drawing By: RKL/1-N-21.ASB Date: 09Dec94 Reference: HANFORD WELLS			


199-N-21



WELL CONSTRUCTION AND COMPLETION SUMMARY			
Drilling Method: Rotary	Sample Method: Air returns	WELL NUMBER: 199-N-26	TEMPORARY WELL NO: 24675
Drilling Fluid Used: Air	Additives Used: Foam, Torg Trim	Hanford II-Area N 5,705	W 6,797
Driller's Name: Nelson 7	WA State Lic Nr: Not documented	Coordinates: N/S N 85,105.38	E/W W 61,686.89
Company: Nelson Well Drilling	Location: Pasco, WA	State NAD83 N 149,410.03m	E 571,056.86m
Date Started: 31Dec80	Date Complete: 03Jan81	Coordinates: N 490,249	E 2,233,420
		Card #: Not documented	T R S
		Elevation	
		Ground surface: 453.1-ft Estimated	
Depth to water: 63.0-ft Jan81 (top-of-casing) 72.1-ft 13Sep94		Elevation of reference point: (455.80-ft) (top of casing) Height of reference point above ground surface: (2.7-ft)	
GENERALIZED STRATIGRAPHY		Driller's Log	
0-10: GRAVEL with COBBLES and SAND with SILT		Depth of surface seal (10-ft nom)	
10-15: GRAVEL with COBBLES and SAND		Type of surface seal,	
15-20: GRAVEL with some SAND		Cement grout to 10-ft	
20-45: GRAVEL 6-in with SAND		9D hole, 9-10-ft	
45-50: GRAVEL 3-in with SAND, SILT		9-in nominal hole, 10-79-ft	
50-55: GRAVEL 3-in, COBBLES, SAND more SILT		8-in casing perforations, 12-77-ft, OGS not documented	
55-79: GRAVEL 3-in, SAND silty		8-in ID carbon steel casing, +2.7-79-ft	
REMEDICATION: 23-24Apr84 by M. Bultena Set telescoping screen		6-in stainless telescoping screen, 61.0-81.5-ft, #10-slot w/1-ft filtered 5-in casing on top	
		Borehole drilled depth: (81.5-ft)	
		DTB=Depth to Bottom, 76.3-ft, 17Feb93	
Drawing By: EKL/1-N-26.A99			
Date : 09Dec94			
Reference : HANFORD WELLS			

199-N-26

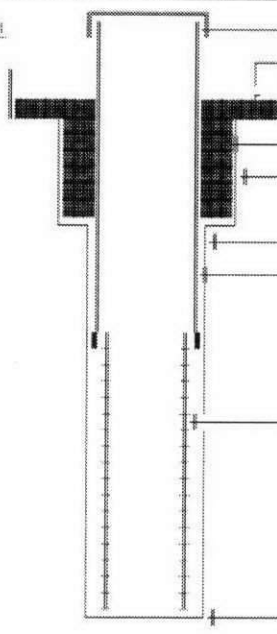

WELL CONSTRUCTION AND COMPLETION SUMMARY			
<b>Drilling</b> Method: Cable tool Fluid Used: Not documented Driller's: Sultana Name: Sultana Company: Not documented Date: 01Sep83 Started: 01Sep83	<b>Sample</b> Method: Hard tool (som) Additives: Not documented Used: Not documented Lic Nr: 9046 Company: Not documented Location: Not documented Date: 09Sep83 Complete: 09Sep83	<b>WELL</b> NUMBER: 199-N-34      TEMPORARY Hanford N-Area      WELL NO: 4683 Coordinates: N/S N 95,999.07      E/W W 59,451.54 State NAD83 N 149,653.39m      E 571,757.41m Coordinates: N 491,048      E 2,235,653 Start Card #: Not documented      T      R      S Elevation Ground surface (ft): 459.6 Estimated	
Depth to water: 56.0-ft Sep83 (Ground surface) 11.3-ft 12Sep94 GENERALIZED      Driller's STRATIGRAPHY      Log			
0-50: COBBLES and BOULDERS 50-78: COBBLES, SAND and SILT		Elevation of reference point: (459.63-ft) (top of casing) Height of reference point above (2.0-ft) ground surface Depth of surface seal (0--18-ft) Type of surface seal: Cement grout to -18-ft 12-in nominal hole, 0--18-ft 9-in nominal hole, -18--78-ft 8-in ID carbon steel casing, 12.0--35-ft (Pulled back from total depth) Telescoping screen, 34--78-ft Borehole drilled depth: (78.0-ft)	
Drawing By: RKL/1-N-34.ASB Date: 14Dec94 Reference: HANFORD WELLS			

199-N-34




WELL CONSTRUCTION AND COMPLETION SUMMARY			
<b>Drilling</b> Method: Cable tool Drilling Fluid Used: Water Driller's Name: O. Ames Drilling Company: Associated Well Drill Date Started: 11Jun87 Date Complete: 25Jun87	<b>Sample</b> Method: Hand tool Additives Used: Not documented MA State Lic. Nr: Not documented Company Location: Not documented	<b>WELL</b> NUMBER: 199-N-56 HANFORD N-AREA: N 6, 396 COORDINATES: N/S N 36, 366 STATE NAD83 N 149, 703.49M COORDINATES: N 451, 231 START CARD #: Not documented ELEVATION: Not documented GROUND SURFACE: 454.3-ft Estimated	<b>TEMPORARY</b> WELL NO: 1310-N #1 W 6, 206 E/W 60, 683 E 517, 395.87M S 4, 234, 467
<div style="display: flex; justify-content: space-between;"> <div style="width: 45%;">           Depth to water: 61.0-ft Burd?            (Ground surface) 70.4-ft 1350594            GENERALIZED Geologist's STRATIGRAPHY LOG            0-46: Sandy GRAVEL            46-60: Silty sandy GRAVEL,                    Ringold Contact @ 46-ft            60-70: Medium SAND            70-74: Gravelly SAND         </div> <div style="width: 50%;"> </div> </div>			
Elevation of reference point: 1459.09-ft (top of casing) Height of reference point above ground surface: 3.8-ft Depth of surface seal: 1.0-4.5-ft Type of surface seal: 4-ft by 4-ft concrete surface pad extending 4.5-ft into annulus 11-in nominal hole, 6-74-ft 10-10 ID stainless steel casing, +3.8-29.0-ft Granular bentonite, 4.5-47.5-ft Bentonite pellets, 47.5-55.5-ft 10-20-mesh silica sand, 53.6-74.0-ft 6-10 #104 stainless steel screen, 59.0-71.0-ft, #20-slot Borehole drilled depth: 74.0-ft			

Drawing By: RML/N-56-ASB  
 Date: 10Dec84  
 Reference: HANFORD WELLS

199-N-56

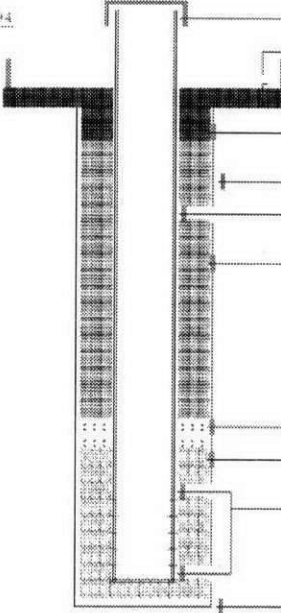

WELL CONSTRUCTION AND COMPLETION SUMMARY			
Drilling Method: Cable tool Drilling Fluid Used: Water Driller's Name: L. Gordon Drilling Company: Associated Well Drill Date Started: 12Jun87 Date Complete: 25Jun87	Sample Method: Hard tool Additives Used: Not documented WA State Lic Nr: Not documented Location: Not documented	WELL NUMBER: 199-N-57      TEMPORARY Hanford N-Area      WELL NO: 1310-N #6 Coordinates: N/S      N 85,535      E/W      W 5,867 State NAD83      N 149,542.05m      E 571,413.17m Coordinates: N 490,692      E 2,234,589 Start Card #: Not documented      T      R      S Elevation Ground surface: 455.5-ft Estimated	
Depth to water: 60.0-ft Jun87 (Ground surface) 69.3-ft 13Sep94 GENERALIZED Geologist's STRATIGRAPHY Log 0-60: Sandy GRAVEL Ringold contact @ 57-ft 60-76: Gravelly silty SAND		 <div style="position: absolute; right: 10px; top: 205px; width: 200px;">           Elevation of reference point: (457.76-ft)            (top of casing)            Height of reference point above ( 2.3-ft )            ground surface            Depth of surface seal ( 0-5.0-ft )            Type of surface seal,            4-ft by 4-ft concrete surface pad            extending 5.0-ft into annulus            11-in nominal hole, 0-76.0-ft            6-in ID stainless steel casing,            +2.3-58.0-ft            Granular bentonite, 5.0-47.0-ft            Bentonite pellets, 47.0-52.0-ft            10-20-mesh silica sand, 52.0-76.0-ft            6-in T304 stainless steel screen,            58.0-73.0-ft, #20-slot            Borehole drilled depth: ( 76.0-ft )         </div>	
<div style="display: flex; justify-content: space-between;"> <div style="width: 30%;">           Drawing By: BKL/I-N-57.AVB            Date : 19Dec94            Reference : HANFORD WELLS         </div> </div>			

199-N-57



WELL CONSTRUCTION AND COMPLETION SUMMARY			
<b>Drilling</b> Method: Cable tool Drilling Fluid Used: Water Driller's Name: O. Amos Drilling Company: Kaiser Engineers Date Started: 21Sep87 Date Completed: 19Nov87	<b>Sample</b> Method: Dart bailer Additives Used: Not documented WA State Lic No: 1224 Company Location: Richmond, WA	<b>WELL</b> NUMBER: 199-N-59 Hanford N-Area Coordinates: N 149,130.43m State NAD83 N 489,397 Coordinates: N 489,397 Start Elevation Card #/Not documented Ground surface: 45.59-ft. Brass cap.	<b>TEMPORARY</b> WELL NO: N 5,878 N 8,152 E 571,381.3m E 2,234,080 T R S
Depth to water: 59.4-ft Sep87 (Ground surface): 71.0-ft 12Sep94 <b>GENERALIZED Geologist's STRATIGRAPHY LOG</b> <div style="display: flex; align-items: flex-start;"> <div style="width: 40%; padding-right: 10px;">           0-25: Silty sandy GRAVEL                (Excavated by backhoe)            20-53: Sandy GRAVEL            63-65: Ringold fm contact            68-70: Silty sandy GRAVEL            70-72.5: Silty SAND         </div> <div style="width: 60%;"> </div> </div>			

199-N-59

A.11




WELL CONSTRUCTION AND COMPLETION SUMMARY			
<b>Drilling</b> Method: Cable tool Drilling Fluid Used: Water Driller's Name: L. Watkins Drilling Company: Kaiser Engineers Date Started: 15Oct87	<b>Sample</b> Method: Hard tool Additives Used: Not documented WA State Lic Nr: Not documented Company Location: Richland, WA Date Complete: 19Nov87	<b>WELL</b> NUMBER: 199-N-64      A4705 WELL NO: Hanford N-Area      N 3,774 Coordinates: N/S      N 85,564      E/W      W 60,030 State NAD83      N      149,561.12m      E      571,561.41m Coordinates: N      490,212      S      2,235,076 Start Card #: Not documented      T      R      S Elevation: Ground surface: 452.2-ft Brass cap	
Depth to water: 58.5-ft Oct87 (Ground surface) 65.4-ft 13Sep94			
<b>GENERALIZED Geologist's STRATIGRAPHY Log</b>			
0-19: Not documented (Excavated by backhoe) 20-49: Sandy GRAVEL 49-64: Silty sandy GRAVEL Ringold contact at 63-ft 64-69.5: Slightly gravelly SAND			
		Elevation of reference point: 454.63-ft (top of casing) Height of reference point above ground surface: 2.4-ft Depth of surface seal: 0-4.3-ft Type of surface seal, 4-ft by 4-ft concrete surface pad extending 4.3-ft into annulus 13-in nominal hole, 0-20-ft Bentonite crumbles, 4.3-14.5-ft 11-in nominal hole, ~20-69.5-ft 6-in ID stainless steel casing, +2.4-54.0-ft Volclay pellets, 44.5-49.0-ft 10-20-mesh silica sand, 49.0-69.0-ft 6-in ID T304 stainless steel screen, 54.0-69.0-ft, #20-slot Borehole drilled depth: 69.5-ft	

Drawing By: RKL/I-N-64.ARR  
 Date: 20Dec94  
 Reference: HANFORD WELLS

A.12

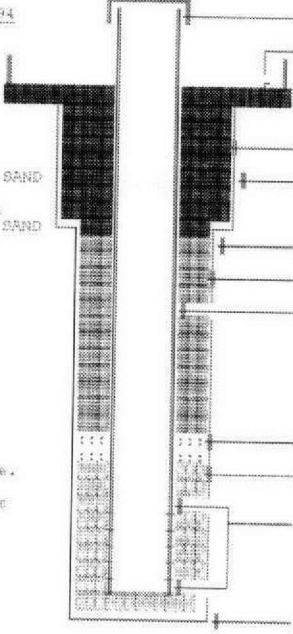

WELL CONSTRUCTION AND COMPLETION SUMMARY			
<b>Drilling</b> Method: Cable tool Fluid Used: Water Driller's: O. Amor Name: O. Amor Company: Kaiser Engineers Date: 16Feb88 Started: 16Feb88	<b>Sample</b> Method: Hard tool Additives: Used: Not documented WA State: Lic No: 1224 Company: Location: Richland, WA Date: Complete: 02Mar88	<b>WELL</b> NUMBER: 199-N-67      TEMPORARY Hanford N-Area      A4711      WELL NO: Coordinates: N/S      N 7,436      W 5,970 State NAD83      N 149,758.35m      E/W      W 60,248 Coordinates: N      493,824      E      2,234,835 Card #: Not documented      T      R      S Elevation: Ground surface: 456.80-ft Brass cap	
Depth to water: 65.0-ft Feb88 (Ground surface: 72.5-ft 13Sep94) <b>GENERALIZED Geologist's STRATIGRAPHY Log</b> 0-14: Sandy GRAVEL 14-19: Silty sandy GRAVEL 19-24: Gravelly silty SAND 24-39: Silty sandy GRAVEL 39-43: Slightly silty gravelly SAND 43-54: Silty sandy GRAVEL Ringold contact at 43-ft 54-59: Slightly silty gravelly SAND 59-74: Silty sandy GRAVEL 74-79: Sandy GRAVEL		 <div style="display: flex; flex-direction: row-reverse;"> <div style="width: 20px; height: 20px; border: 1px solid black; margin-bottom: 5px;"></div> <div style="margin-left: 10px;">           Elevation of reference point: ( 456.46 )            (top of casing)            Height of reference point above ground surface ( 1.7-ft )            Depth of surface seal ( 0-20-ft )            Type of surface seal, 4-ft by 4-ft concrete surface pad            Cement grout to 20-ft            13-in nominal hole, 0-19-ft            11-in nominal hole, 19-79-ft            Granular bentonite, 20.0-49.5-ft            6-in ID stainless steel casing, 1.7-60.5-ft            Bentonite pellets, 49.5-54.5-ft            10-20-mesh silica sand, 54.5-79.0-ft            6-in ID T304 stainless steel screen, 60.5-76.0-ft, #20-slot            Depth bottom of borehole: ( 79.0-ft )         </div> </div>	
<b>DRILLING NOTE:</b> Well drilled in radiation zone. Contamination encountered while drilling. Field readings of 3-10,000 dpm 40-75-ft.			
Drawing By: RKL/L-N-67.ASB Date: 21Dec94 Reference: HANFORD WELLS			

199-N-57



0500264

**WELL CONSTRUCTION AND COMPLETION SUMMARY**

Drilling Method: Cable Tool	Sample Method: Grab/Spill Spoon	WELL NUMBER: 199-N-71	A4714	TEMPORARY WELL NO: None
Drilling Fluid Used: NA	Additives Used: None	Coordinates: N	Not documented	
Driller's Name: Joe Ockert	WA State Lic Nr: Not Available	Coordinates: E	Not documented	
Drilling Company: KEH Const. Forces	Company Location: Hanford	Start Card #:	Not Available	
Date Started: 07Aug91	Date Completed: 26Oct91	Elevation Ground Surface:		

Depth to Water: 68.1 ft 28Oct91  
(Ground surface)

Elevation of Reference Point: m

GENERALIZED STRATIGRAPHY Geologist's Log


Height of Reference Point Above Ground Surface:  
Depth of Surface Seal: 18 ft.  
Type of Surface Seal: 4x4 Concrete Pad

0 - 5 ft : Slightly Gravelly Silt  
5 - 10 ft : Silty Sandy Gravel  
10 - 25 ft : Gravelly Sandy Silt

25 - 45 ft : Gravel

45 - 85 ft : Sandy Gravel

85 - 87.05 ft : Sandy Gravel

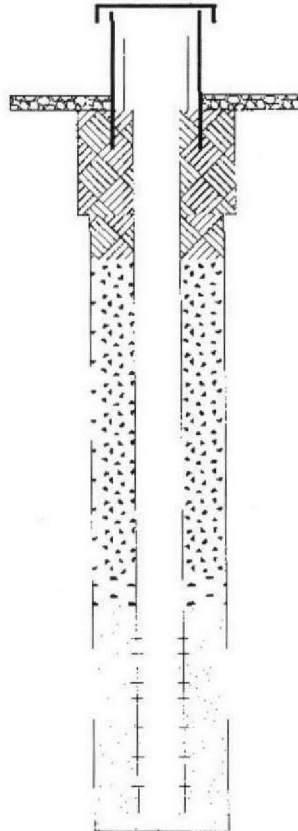

Fill	Casing	Screen
0 - 12.61 ft : 13-inch hole Cement	0 - 12.61 ft : 12-3/4" CS Temp. Welded Csg.	0 - 12.61 ft : 13 inch
12.61 - 18 ft : 11-inch hole Cement	12.61 - 18 ft : 10-3/4" CS Temp. Welded Csg.	18 - 55.8 ft : 11-inch hole Bentonite Crumbles
18 - 55.8 ft : 11-inch hole Bentonite Crumbles	55.8 - 59.7 ft : 11-inch hole Bentonite Pellets	59.7 - 84.8 ft : 10-20 Silica Sand
55.8 - 59.7 ft : 11-inch hole Bentonite Pellets	59.7 - 84.8 ft : 11-inch hole 10-20 Silica Sand	84.8 - 87.05 ft : 11-inch hole 10-20 Silica Sand
59.7 - 84.8 ft : 11-inch hole 10-20 Silica Sand	84.8 - 87.05 ft : 11-inch hole 10-20 Silica Sand	84.8 - 87.05 ft : 11-inch hole 10-20 Silica Sand
84.8 - 87.05 ft : 11-inch hole 10-20 Silica Sand		84.8 - 87.05 ft : 11-inch hole 10-20 Silica Sand
87.05 ft : Borehole drilled depth		87.05 ft : Borehole drilled depth

87.05 ft : Borehole drilled depth  
0 - 12.61 ft : 13-in. 12-3/4" Temp. Welded Csg. w/13" shoe  
12.61 - 87.05 ft : 11-in. 10-3/4" Temp. Welded Csg. w/11" shoe

Drawing By: DLF  
Reference: Hanford Wells  
Revision: 0  
Revision Date: 18Dec97  
Print Date: 18Dec97



Report Form: WELLS Project File: WELLS.GPJ

199-N-71

A.14



0503091

## WELL CONSTRUCTION AND COMPLETION SUMMARY

Drilling Method:	Cable Tool	Sample Method:	Grab/Split Spoon	WELL NUMBER:	199-N-72	A4715	TEMPORARY WELL NO:	None
Drilling Fluid Used:	NA	Additives Used:	None	Coordinates N:	Not documented			
Driller's Name:	J. Ockert	WA State Lic. No.:	Not Available	Coordinates E:	Not documented			
Drilling Company:	KEH Constr. Forces	Company Location:	Hanford	Start Card #:	Not Available			
Date Started:	30Aug91	Date Completed:	30Oct91	Elevation Ground Surface:				

Depth to Water: 65.1 ft 25Oct91  
(Ground surface)

Elevation of Reference Point m

GENERALIZED STRATIGRAPHY Geologist's Log

Height of Reference Point Above Ground Surface:

Depth of Surface Seal: 20.5 ft.

Type of Surface Seal: 4x4 Concrete Pad


0 - 35 ft : Sandy Gravel

35 - 55 ft : Gravel

55 - 65 ft : Sandy Gravel

65 - 80 ft : Gravel

80 - 85.01 ft : Sandy Gravel

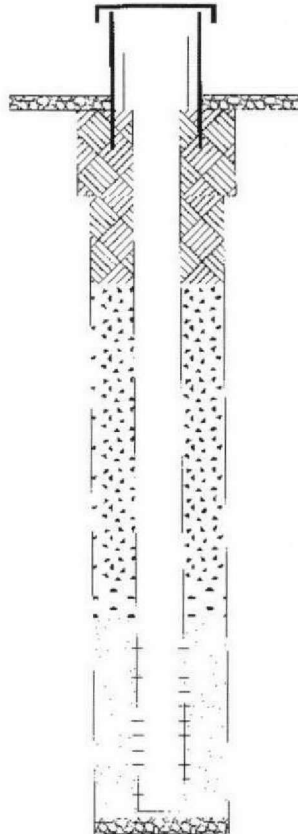

Fill Casing Screen

0 - 10.09 ft : 13 inch  
13-inch hole  
Cement

10.09 - 20.5 ft : 4" Perm. Casing  
11-inch hole  
Cement

20.5 - 55.5 ft : 11-inch hole  
Bentonite  
Crumbles

55.5 - 59.3 ft : 11-inch hole  
Bentonite Pellets

59.3 - 82.25 ft : 11-inch hole  
10-20 Silica Sand

82.25 - 83 ft : 11-inch hole  
10-20 Silica Sand

83 - 85.01 ft : 11-inch hole  
Slough

0 - 10.09 ft : 13-in. 12-3/4" CS Temp.  
Casing

10.09 - 85.01 ft : 11-in. 10-3/4" CS  
Temp. Casing

61.22 - 82 ft :  
4 inch  
4" .020 SS Wire  
Wrap Pipe Size

82 - 82.25 ft :  
4 inch  
End Cap

85.01 ft : Borehole drilled depth

0 - 10.09 ft : 13-in. 12-3/4" CS Temp.  
Casing

10.09 - 85.01 ft : 11-in. 10-3/4" CS  
Temp. Casing

Drawing By: DLF  
Reference: Hanford Wells  
Revision: 0  
Revision Date: 27Jan98  
Print Date: 27Jan98



Report Form: WELLS Project File WELLS.GPJ

199-N-72



0500305

## WELL CONSTRUCTION AND COMPLETION SUMMARY

Drilling Method:	Cable Tool	Sample Method:	Grab/Split Spoon	WELL NUMBER:	199-N-73 A4716	TEMPORARY WELL NO:	None
Drilling Fluid Used:	NA	Additives Used:	None	Coordinates: N	Not documented		
Driller's Name:	D. Kruger	WA State Lic. No.:	Not Available	Coordinates: E	Not documented		
Drilling Company:	KEH Constr. Forces	Company Location:	Hanford	Start Card #:	Not Available		
Date Started:	26Aug91	Date Completed:	16Sep91	Elevation Ground Surface:			

Depth to Water: 68.3 ft 16Sep91  
(Ground surface) 69.3 ft 30Oct91

GENERALIZED STRATIGRAPHY Geologist's Log

Elevation of Reference Point: m


Height of Reference Point Above Ground Surface:

Depth of Surface Seal: 19.7 ft.

Type of Surface Seal: 4x4 Concrete Pad

0 - 55 ft : Gravel

55 - 89.1 ft : Sandy Gravel

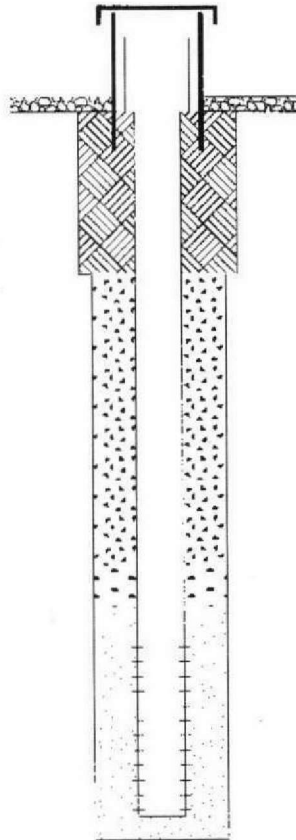

Fill	Casing	Screen
0 - 19.7 ft : 13-inch hole Cement	0 - 19.92 ft : 13 inch 12-3/4" CS Temp. Welded Csg. 0 - 65.6 ft : 4 inch 4" Casing	
19.7 - 19.92 ft : 13-inch hole Bentonite Crumbles	19.92 - 89.3 ft : 11 inch 10-3/4" CS Temp. Welded Csg.	
19.92 - 55.5 ft : 11-inch hole Bentonite Crumbles		
55.5 - 60.6 ft : 11-inch hole 3/8" Bentonite Pellets		
60.6 - 86.4 ft : 11-inch hole 10-20 Silica Sand		65.6 - 86.1 ft : 4 inch 4" 020 SS Wire Wrap Pipe Size
86.4 - 89.3 ft : 11-inch hole 10-20 Silica Sand	86.1 - 86.4 ft : 4 inch	

89.1 ft : Borehole drilled depth

0 - 19.92 ft : 13-in. 12-3/4" Carbon Steel  
Temp. Casing  
19.92 - 89.1 ft : 11-in. 10-3/4" Carbon  
Steel Temp. Casing

Drawing By: DLF  
Reference: Hanford Wells  
Revision: 0  
Revision Date: 19Dec97  
Print Date: 19Dec97



199-N-73



0500149

## WELL CONSTRUCTION AND COMPLETION SUMMARY

Drilling Method:	Air Rotary	Sample Method:	Grab/Spit Spoon	WELL NUMBER:	199-N-77	A5442	TEMPORARY WELL NO:	None
Drilling Fluid Used:	NA	Additives Used:	None	Coordinates: N	Not documented			
Driller's Name:	D. Mingo	WA State Lic. Nr:	Not Available	Coordinates: E	Not documented			
Drilling Company:	Jensen Drilling	Company Location:	Richland, WA	Start Card #:	Not Available			
Date Started:	30Jul92	Date Completed:	14Oct92	Elevation Ground Surface:				

Depth to Water: 80.45 ft 24Sep93  
(Ground surface)

Elevation of Reference Point: m


Height of Reference Point Above Ground Surface:

Depth of Surface Seal: 8.0 ft

Type of Surface Seal: 4x4 Concrete Pad

## GENERALIZED STRATIGRAPHY Geologist's Log

0 - 5 ft: Gravel  
5 - 13 ft: Sandy Gravel  
13 - 20 ft: Gravel  
20 - 29 ft: Sandy Gravel  
29 - 38 ft: Sandy Gravel  
38 - 42 ft: Gravel  
42 - 45 ft: Sandy Gravel  
45 - 48 ft: Gravel  
48 - 49 ft: Sand  
49 - 52 ft: Sandy Gravel  
52 - 55 ft: Sand  
55 - 56 ft: Gravel  
56 - 57 ft: Sand  
57 - 58 ft: Gravel  
58 - 57 ft: Sandy Gravel  
97 - 100 ft: Silt and Clay  
100 - 102 ft: Silty Sand  
102 - 103 ft: Silty Clay

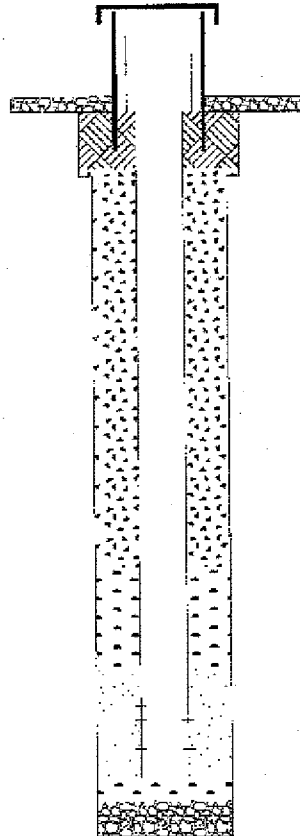

FIN	Casing	Screen
0 - 5 ft:	0 - 9.2 ft:	
13-inch hole	13 inch	
Cement	12-3/4" CS Temp.	
5 - 9.2 ft:	Welded Csg.	
13-inch hole	0 - 84.36 ft:	
Bentonite	4 inch	
Crumbles	4" Perm. Casing	
	9.2 - 103 ft:	
	11 inch	
	10-3/4" CS Temp.	
	Welded Csg.	
9.2 - 64.7 ft:		
11-inch hole		
Bentonite		
Crumbles		
64.7 - 79.4 ft:		
11-inch hole		
Bentonite Tablets		
79.4 - 94.3 ft:		
11-inch hole		
20-40 Silica Sand		
94.3 - 94.6 ft:		
11-inch hole		
20-40 Silica Sand		
94.6 - 98.1 ft:		
11-inch hole		
Bentonite Tablets		
98.1 - 103 ft:		
11-inch hole		
Slough		
		84.36 - 94.3 ft:
		4 inch
		4" .010 SS Wire
		Wrap Pipe Size
		94.3 - 94.6 ft:
		4 inch
		4" PVC Cap

103 ft: Borehole drilled depth

0 - 9.2 ft: 13-in. 12-3/4" Carbon Steel  
Temp. Casing  
9.2 - 103 ft: 11-in. 10-3/4" Carbon Steel  
Temp. Casing

Report Form: WELLS Printed File: WELLS.GPJ

Drawing By: DLF  
Reference: Hanford Wells  
Revision: 0  
Revision Date: 19Dec97  
Print Date: 19Dec97



199-N-77



## Distribution

### No. of Copies

#### **ONSITE**

#### **9 DOE, Richland Operations Office**

J. G. Morse (5)	A6-38
K.M. Thompson	A6-38
Public Reading Room	H2-53
Administrative Record (2)	H6-08

#### **3 Bechtel Hanford, Inc.**

BHI Document and Information Services	H0-09
D.M. Yasek (2)	H0-03

### No. of Copies

#### **4 Fluor Hanford, Inc.**

J.V. Borghese	E6-35
V.G Johnson	E6-35
R.F. Raidl	E6-35
J.A. Winterhalder	E6-35

#### **12 Pacific Northwest National Laboratory**

C.J. Chou	K6-81
J.S. Fruchter	K6-96
M.J. Hartman (5)	K6-96
S.P. Luttrell	K6-96
D.L. Stewart	K6-96
D. Vela (project file)	K6-96
Hanford Technical Library (2)	P8-55

#### **3 Washington State Department of Ecology**

D. Goswami	B5-18
J. Price	B5-18
W.W. Soper	B5-18